


PRODUCT DESCRIPTION

DST/C temperature probe for p-line Web Sensors is designed to measure temperature of air (°C or °F) in non-aggressive environment.

Digital sensors for temperature measurement can be adjusted by the user using the free *TSensor* program (see www.cometsystem.com).

TECHNICAL SPECIFICATION

Temperature measuring range	-30 to +80 °C
Accuracy of temperature measurement	± 0.5 °C from -10 to +80 °C ± 2.0 °C below -10 °C
Temperature operating range	-30 to +80 °C
Relative humidity operating range	0 to 100 %RH (no condensation)
Protection class	IP20
Recommended calibration interval	2 years
Working position	vertically with sensor cover downwards
Weight	15 g

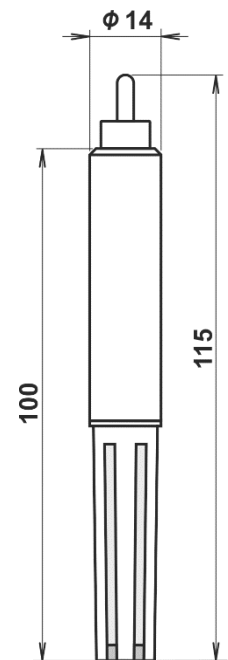

INSTALLATION AND OPERATION

Turn off the power supply of the Web Sensor P8xx1, connect the probe and turn on the power again. Using *TSensor* program or web interface find this “new” probe and finally check the measured values. Pay attention to the location of the Web Sensor with probe. Incorrect choice of working position could adversely affect accuracy and long-term stability of measured values.

Probe does not require any special maintenance. We recommend you periodic calibration for measurement accuracy validation.

WARNINGS



- Don't use and don't store the probe without the sensor cover.
- It is not recommended to use the probe for long time under condensation conditions.
- The p-line Web Sensor with attached probe install always vertically with the sensor cover downwards.
- Installation, electrical connection and commissioning should be performed by qualified personnel only.
- The probe contains electronic components; it needs to be liquidated according to legal requirements.
- **To supplement the information** provided in this data sheet, use the manuals and other documentations which are available at www.cometsystem.com.



WARRANTY CERTIFICATE

This product has three years warranty since the date of sale to the end user. Defects due defective materials, defective manufacturing or design will be repaired free of charge by the manufacturer. The location of repair is at manufacturer's. No warranty is given to products operated in conditions not matching the conditions specified by the manufacturer in instruction manual. Also no warranty is given to products which were modified by the user, products with broken seal, products which were connected to power or input signals not matching the technical specification (Instruction manual). No warranty is given to consumables, e.g. batteries, fuses and eventual changes of parameters created by wear (influence of aggressive environment etc.).

ZÁRUČNÍ LIST

Na tento přístroj je poskytována záruka tři roky od jeho prodeje uživateli. Vady vzniklé v této lhůtě prokazatelně vadnou konstrukcí, vadným provedením nebo nevhodným materiálem budou bezplatně opraveny výrobcem, přičemž místo plnění záruky je sídlo firmy COMET.

Záruka zaniká během reklamační, resp. záruční doby, provede-li uživatel (obchodní nebo montážní organizace) na přístroji nedovolené úpravy nebo změny, poruší-li pečeti (u zapečetěných přístrojů), zapojí-li přístroj na nesprávné napájení nebo na nesprávné vstupní měřené veličiny, byl-li provozován v rozporu s technickými podmínkami (návod k obsluze). Záruka se rovněž nevztahuje na spotřební materiál, např. baterie, pojistky a dále na možné změny parametrů přístroje vzniklé jeho opotřebením (vliv agresivního prostředí apod.).

Zjistí-li uživatel, obchodní nebo montážní organizace závadu během jeho záruční doby, uplatní reklamaci u organizace, která přístroj dodala. Reklamace bez přiloženého záručního listu nebude uznána.

Technickou podporu a servis zajišťuje distributor tohoto přístroje. /
Technical support and service is provided by the distributor of this device.

Model / Typ:

Serial Number / Výrobní číslo:

Date of sale / Datum prodeje:

DISTRIBUTOR